FY20 - PROJECT PHOTO GALLERY

PROJECT NAME: PIC-SR 316/752-13.05/0.000 PID: 107824 County: Section:

PIC 316 13.05-13.68

1. PROJECT IDENTIFICATION:

PIC-SR 316 – 13.05-13.68 Functional Class: 05 – Major Collector (Rural)



The following pages represent ODOT Minutes from a joint meeting on July 7, 2017. After that meeting a site review was done to document roadway, stormwater, curb, and sidewalk issues. Photo taken help highlight those identified issues. On January 23, 2018 a Drainage Field Review was provided by ODOT. These issues developed into the Joint ODOT/Ashville 316 Improvement Project.

Following those 12 pages ODOT Minutes are five pages of Exhibits by Tebbe Civil Engineering, LLC. These Exhibits provide an engineering response to the issues identified in the July 2017 Minutes.

Ashville Meeting:

10AM 7/7/2017

Ashville Municipal Office

<u>In attendance</u>: Toni Turowski – D6 Planning Engineer, Brian Davidson – LPA Coordinator, Grace Wesner – Pavement Engineer, Chris Tebbe – Project Manager/Associate, Franklin Christman – Village Administrator, Greg Sturgill, Dave Ballard – Street Department, Jim Welsh – Water Utility Department and Adam Kehoe – Wastewater Operator of Record

- Define the Issue:

- o Center of SR-316 is higher than sidewalk & walkway up to houses
 - Causing sidewalks (& even sometimes houses) to have flooding
- \circ Center of roadway is \sim 1' higher than shoulders
 - By visual inspection
- Plum is the worst intersection
 - There used to be a signal for Plum & Madison, but it was not warranted
 - This intersection is offset & had only one signal
- Madison & Long Street intersection:
 - Good location for pedestrian flashers
 - There is a lot of pedestrian traffic at this location
- Ashville is continually growing:
 - ~4750 people in 2020
 - In 2030 the population will definitely be 5000 which will change things with ODOT
 - The increase in population is causing an increase in traffic, which is reason for concern with the current roadway conditions
 - Prefer to react to roadway conditions as soon as possible, instead of backtracking once the population has grown

- Recap & Schedule:

- o ODOT will commit to the following:
 - Survey
 - Cores
 - Camera the drainage
- o Proposed Timeline:
 - Have cores, survey, etc. done by 10/1/2017 (ODOT)
 - Have analysis of the above information done by 12/1/2017 (ODOT)
 - Apply for OPWC funds by May 2018 (Ashville)
 - This is currently a fiscal year 2020 project, to be constructed in calendar year 2019

- Collect Information:

- ODOT & Ashville intend to walk to site today and get an understanding of the current issues
- Jim & Adam will be good contacts when taking cores
 - Let them know prior to coring so everything can be marked
- *All core locations are being placed where there are existing drainage structures
 - Cores will be taken across the roadway where there are these structures

Old CB & new CB in front of Ashville Cleaning Center (start of resurfacing project)



- o Concrete collars on manholes & water valves from Station St. throughout
- o Start S. of Station St. getting cores
- o From Station Street to plum street, there is no sanitary
- o In front of Kelli Jo's flowers (Harrison & Long St)
 - New sidewalk & higher curb
- o #1 drainage location:
 - South of Station Street, on the east side of the roadway
- o #2 drainage location:
 - North of Harrison Street, on the east side of the roadway
- o #3 drainage location:
 - South of Harrison Street, on the east side of the roadway
- o #4 drainage location:
 - North of Cherry Street, on the east side of the roadway



- o North of Cherry Street:
 - Sandstone box pipe across the roadway, ~4-5' wide
 Page 3 of 28

- o #5 drainage location:
 - North of Cherry Street, on the west side of the roadway
- o #6 drainage location:
 - North of Cherry Street, on the west side
 - In the sidewalk/driveway next to houses





- o #7 drainage location:
 - North of Cherry Street, on the west side
 - In the sidewalk, in front of the roadway
- o #8 drainage location:
 - North of Plum Street, on the east side of the roadway





- > #9 drainage location:
 - North of Madison Street, on the West side of the roadway

- o #10 & 11 drainage locations:
 - In between Madison Street & Church Street, on the East side of the roadway





- o #12 drainage location:
 - In between Madison Street & Church Street, on the West side of the roadway
- o #13 drainage location:
 - South of Church Street, on the West side of the roadway
- o Get survey of the crown of the roadway, throughout
- o #14 drainage location:
 - SR-316W & Long Street, on the West side of the roadway
- #15 drainage location:
 - SR-316W & Long Street, on the West side of the roadway (corner)





#16 drainage location:

- SR-316W and Long Street, on the East side of the roadway (corner)
- o #17 drainage location:
 - SR-316W in the middle of the roadway





- o #18 drainage location:
 - Once you turn onto SR-316W
- o #19 drainage location:
 - Catch basin in an alley on the West side of the roadway





O There is an existing pavement break after the railroad

- o #20 drainage location:
 - In between the RR crossings on the east side of the roadway
- o #21 drainage location:
 - In between the RR crossings on the west side on the roadway





- o #22 drainage location:
 - In between the RR crossings on the east side of the roadway located by the sistirn



- o #23 & 24 drainage locations:
 - At Cromley Street, on the East side of the roadway

Curb built on top of curb – south of Cromley Street





- o #25 drainage location:
 - In between Cromley Street and Scioto Street



- o #26 drainage location:
 - Southeast corner of Scioto Street intersection

- o #27 & 28 drainage locations:
 - Northeast corner of Scioto Street Intersection





- o #29 drainage location:
 - Southwest corner of Scioto Street Intersection
- o #30 drainage location:
 - Northwest corner of Jefferson Avenue Intersection
- o #31 drainage location:
 - Southeast corner of Jefferson Avenue Intersection
- o #32 drainage location:
 - Under the RR on the east side of SR-316
 - This is past what we will resurface with the future project





- o #33 drainage location:
 - Under the RR on the west side of SR-316
 - This is past what we will resurface with the future project
- o #34 drainage location:
 - Down center alley





- o #35 drainage location:
 - Down center alley



- o #36 drainage location:
 - Down center alley
- #38 core location:
 - o On Madison Avenue on the left side (heading toward SR-316)
 - o #37 drainage location:
 - On Madison Avenue on the right side (heading toward SR-316)





- o #38 drainage location:
 - On Madison Avenue on the left side (heading toward SR-316)



Page 11 of 28

- Scope Analysis:

 Grace Wesner (ODOT) to head the analysis of SR-316 based off of the information collected during pavement coring, survey and video of the drainage structures

- Funding Discussion

- If the future improvements to SR-316 become much larger than just a resurfacing,
 ODOT will still commit to the surface course, which is what would have been done with the current construction project
 - This will help with scoring with OPWC
 - ODOT will try to combine SR-316 with a larger project
 - This will also help obtain funding from OPWC

- Other Discussion Items:

- o Intersection improvement at SR-752 & SR-316
- o Ashville future intersection improvements:
 - Want to improve traffic & pedestrian walkways
- o Ashville had a \$14M project to upgrade the wastewater system
- o RTPO Franklin is on the committee for this
- o Ashville has a webpage for every project they do
 - The last 7 years of projects are listed on this webpage

- Other Background Information:

- O Started the field review at the intersection of SR-752 & SR-316 to get an idea of what future intersection improvements will look like
 - This is what the intersection of Long Street and Main Street is proposed to look like
- o The sidewalk will extend from SR-752 to Station Street (along SR-316) on the West side as one of Ashville's projects
- Station Street & Long Street (SR-316) Intersection:
 - Realignment project
 - Re-warrant signal
 - Get mast arms
 - Sidewalks (ADA Compliance)
 - Have ROW on west side of Station street to realign roadway
- Long Street & 316W intersection:
 - Ashville wants this to look like the SR-752 & SR-316 intersection in the future
 - There is a lot of truck traffic through this intersection
- Ashville expects that Long Street/Ashville Pike will eventually be journalized as a state route to connect with SR-762

SR-316 – Drainage Field Review 11/15/2017 – Jon Adams, Nick Villaveces & Grace Wesner

Jefferson Avenue:

- One 4'x4' depressed apron (shown in the photo below)













Scioto Street:

- 4'x4' depressed apron in the following locations:
 - o 1 in the NE corner
 - o 1 in the SW corner
- One 5'wide x 3'long depressed apron in the SE corner
- See photo below:





In between RR Tracks - ~SLM 13.25:

- Replace with a CB 6 (see photo below)
 - This is on the North side of the road (right in front of Ashville Grain, LLC)



In alley at ~SLM 13.305:

- Adjust CB to grade (see photo below)



Main Street/Long Street Intersection (where SR-316 turns):

- Two 4'x4' depressed aprons
 - o 1 in the NW corner
 - o 1 in the NE corner



Wright Street:

- Propose putting a 3A CB in the location on the photo shown below
 - o There is no other drainage at this intersection
- The Village has tried to grind here
 - o If we do more there will be a lip at both curb ramps







Church Street:

- One 4'x4' depressed apron in the SE corner
 - Can't grind anymore here unless we recommend replacing the curb ramp → there is already a lip
- It would be ideal to install a CB 3A on the South side of Church street (it is the low point)
 - o This isn't our street, what do we do here?





Between Church Street and Madison Ave - ~SLM 13.45:

- Add 4'x4' depressed aprons at all 3 CB's shown in the photo below
 - o Replace the CB on the West side with a CB 3A



Plum Street:

- One 4'x4' depressed apron (shown in the photo below)
- Suggested installing a CB 3A on Plum Street in the location shown in the second photo below









Cherry Street

- Three 4'x4' depressed aprons are needed in the locations shown
- Need a CB 6 in the SE corner of the intersection (shown in the second photo below)
- 18' wide lanes in this location
- 6" wide openings at CB's





Harrison Street:

- Replace with a 3A CB (use the standard apron detail)
 - o Location shown in the photo below
- Grind 6' around the radius from crosswalk to CB



CORE#	DIB	ROUTE	AsBuild Core	DEPTH to	DEPTH	Donth of Aggregate nor Blan	Offset	Netes
CORE #	DIK	ROUTE	SLM	MacAdam	Aggregate	Depth of Aggregate per Plan	Offset	Notes
					hole -7.5"			can't mill off 3" here, no brick
1	WB	316	13.65		asphalt -5"		right wheel path	max 3.5" to bad asphalt
					hole - 7.5"		left of the continuous	penetration macadam is the base
2	WB	316	13.65		aspahlt - 4.5"		longitudinal crack	good material, do not want to
							iongitudinal crack	disturb
3	WB	316	13.59		hole - 5.5"		crown	waterbound macadam - good
					asphalt - 3" hole - 10"		shoulder/right wheel noth	material structurally good asphalt concrete
4	WB	316	13.55		asphalt - 4.5"		shoulder/right wheel path - across from Cherry Street	under, not sure if it is a gutter
					hole - 8"		righ wheel path - possible old	asphalt and penetration
5	WB	316	13.55		asphalt - 5.5"		waterline cut	macadam
					hole - 7"		left of the continuous	asphalt with waterbound
6	WB	316	13.52		asphalt - 3"		longitudinal crack	macadam
7	WB	316	13.45		hole - 5.5"		shoulder/right wheel path -	asphalt with waterbound
	WB	310	15.45		asphalt - 3"		near Church Street	macadam
					hole - 7.5"		right of the continuous	asphalt with waterbound
8	WB	316	13.4		asphalt - 5"		longitudinal crack	macadam - different than the
								trend - still good material
9	WB	316	13.4		hole - 6"		left of the continuous	asphalt on top of possible
					asphalt - 3" hole - 5"		longitudinal crack crown - just before SR-316	delaminated asphalt base 3" of asphalt on top of
10	WB	316	13.36		asphalt - 3"		turns onto Main Street	penetration macadam
					hole - 5"			·
11	WB	316	13.31		asphalt - 5"		left of the lognitudinal crack	5" of asphalt on top of brick
12	WB	316	13.31		hole - 5"		right of the longitudinal crack	5" of asphalt on top of brick
12	WB	510	15.51		asphalt - 5"		right of the longitudinal crack	5 of asphalt on top of brick
13	WB	316	13.23		hole - 4"		crown - just pastall of the RR	4" of asphalt on top of brick
					asphalt - 4"		tracks	т образования
14	WB	316	13.19		hole - 6"		near edge of pavement	6" of asphalt on top of brick
					asphalt - 6" hole - 5"			
15	WB	316	13.11		asphalt - 5"		right wheel path	5" of asphalt on top of brick
					hole - 5.5"			
16	WB	316	13.09		asphalt - 5.5"		crown	5.5" of asphalt on top of brick
-					·			
17	EB	316	13.07		hole - 4" asphalt - 4"		near edge of pavement/right wheel path	4" of asphalt on top of brick
					hole - 9"		wheel path	
18	EB	316	13.15		asphalt - 5"		crown	asphalt on brick
					hole - 11.5"			
19	EB	316	13.25		asphalt - 7"		left wheel path	7" of asphalt on brick
20	ED	216	12.26		hole - 8"		poyt to surb	asphalt on ton of concrete
20	EB	316	13.36		asphalt - 8"		next to curb	asphalt on top of concrete
					hole - 6.5"			3" of asphalt on some base
21	EB	316	13.46		asphalt - 3"		right of longitudinal crack	material - possibly macadam - do
-								not want to disturb this
22	ЕВ	316	13.46		hole - 6.5"		left of longitudinal crack	3" of asphalt - very thin
					asphalt - 3"			
23	EB	316	13.57		hole - 7.5"		right of longitudinal crack	asphalt on top of penetrating
					asphalt - 3.5"			macadam (possibly)
24	EB	316	13.65		hole - 7.5"		left of longitudinal crack	3" of asphalt on some sort of
					asphalt - 3"			base
I								

*The proposed core locations are marker with lath that has orange ribbon
*The SLM range for inside shoulder buildup are marked with lath that has white ribbon

ODOT's proposed recommendations for a fix to SR-316 within the Village of Ashville. Below are some meeting minutes, as well as a link to the FTP site that contains a sample task list, LPA Scope of Services and the survey data collected by ODOT.

Meeting Minutes:

- In Attendance: Franklin Christman, Chris Tebbe, Laura Wright, Toni Turowski, Brian Davidson and Grace Wesner
- Option 1 The Village of Ashville is favorable to a modified Option 1 that is more affordable
 - o Curb and gutter replacement
 - The Village of Ashville wishes to replace curb and gutter where necessary and potentially reduce centerline pavement thickness and flatten the cross slope in order to maximize curb reveal/preserve the curb
 - There was a lot of emphasis on making sure the curb is lower than the sidewalk.
 - ODOT requests that the Village of Ashville mark out the locations where curb and gutter is to be preserved at a future time
 - ODOT plans to take additional pavement cores in the areas marked out by the Village
 - o Full-depth pavement repairs adjacent to curb and gutter replacement (2' wide)
 - There was discussion about making these repairs wider that 2'
 - ODOT used a 2' wide repair as a minimum, but we are in agreement that a wider repair would be beneficial.
 - o 1.5" mill and fill
 - There are concerns about the current cross slope
 - A more detailed survey may be needed to determine if the current cross slope is a safety issue
 - If at all possible, the Village wishes to flatten the cross slope by milling deeper and placing less asphalt.
 - o Potential drainage work (catch basins, conduit, etc.)
 - A more detailed survey will need performed in order to determine which drainage structures need replaced
 - The Village of Ashville would also like to include some of the following items of work, if possible:
 - Traffic signal and pedestrian crossing improvements
 - The Village requests that ODOT determine if three signals are warranted within the project limits Which signals does the Village want checked for warranty?
 - The Village understands that if the signals are not warranted they need to be removed
 - Approximately 34 curb ramps
 - Sidewalk improvements
- The Village intends to pursue and apply for the following funding sources:
 - CDBG (Community Development Block Grant) for sidewalks and ADA ramps where eligible (2018 & 2020)
 - OPWC (Ohio Public Works Commission) in fall of 2018 for FY20 funds (available July 1, 2019)

- o ODOT TAP (Transportation Alternative Program
 - http://www.dot.state.oh.us/Divisions/Planning/LocalPrograms/Documents/TAP/TAP %202018%20Program%20Guidance.pdf)
- MORPC
- ODOT Small City (pending 2020 Census results) -http://www.dot.state.oh.us/Divisions/Planning/LocalPrograms/Small%20City%20Program%20Documents/Small%20City%20Program%20Guidelines.pdf
- Project timeframe:
 - o For now, ODOT asks that the Village of Ashville review the documents provided (survey, sample task list, LPA Scope of Services) and respond by 3/1
 - The project timeframe can move forward beginning March 1
 - This project will be an ODOT FY20 project most likely with construction beginning in Calendar Year 2020
- Project Designer
 - o This will be a Part 1/Part 2 project
 - ODOT will complete the design for the resurfacing (1.5" mill/fill) on SR-752
 - The Village of Ashville will need to complete the design for SR-316 because of the heftier design efforts, such as the curb and gutter replacement, any drainage work and the full depth pavement repair locations, along with the resurfacing on SR-316
 - This will make it clearer to construction how the Part 1 and Part 2 project is split
- Near Future Action Items:
 - The Village of Ashville to review the documents provided by ODOT and provide responses by 3/1/18
 - ODOT to determine if further pavement coring needs performed
 - If ODOT decides to move forward with this, ODOT requests that the Village of Ashville mark out where curb and gutter replacements are needed, prior to the pavement coring
- FTP Server link:
 - o <u>ftp://ftp.dot.state.oh.us/pub/Districts/D06/download/Ashville_TaskList_Scoping_Surve_y/</u>

If you have any comments or questions about the meeting minutes or action items, please let me know. ODOT looks forward to the continued partnering on this project.

Thank you,

Grace Wesner


Transportation Engineer 2


ODOT District 6, 400 E. William Street, Delaware, Ohio 43015

Phone: 740.833.8160


Grace.Wesner@dot.ohio.gov



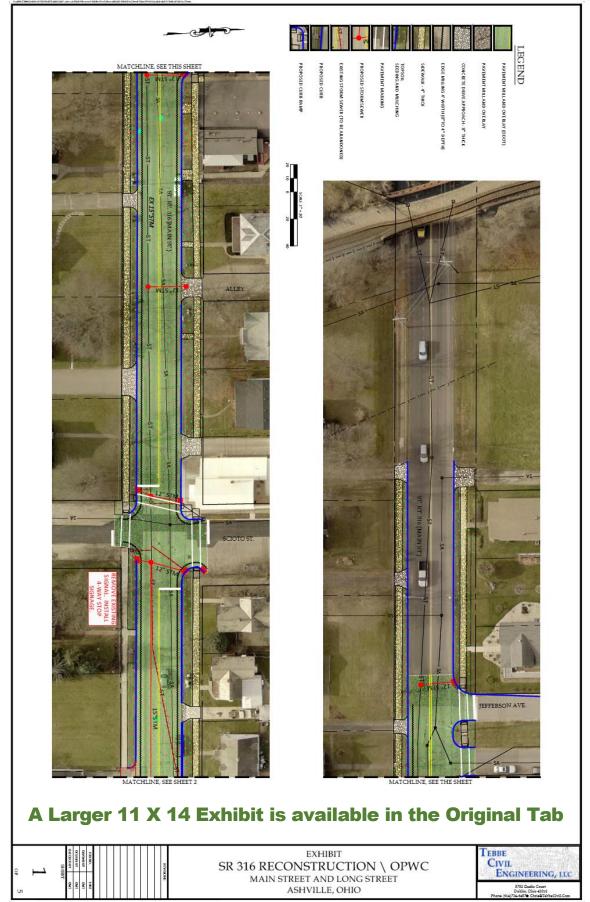

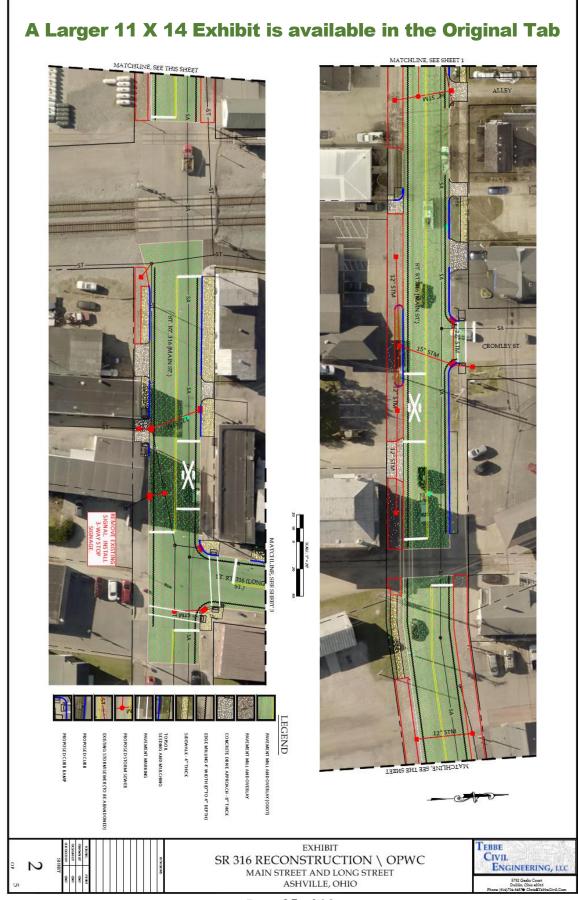

Page 25 of 28

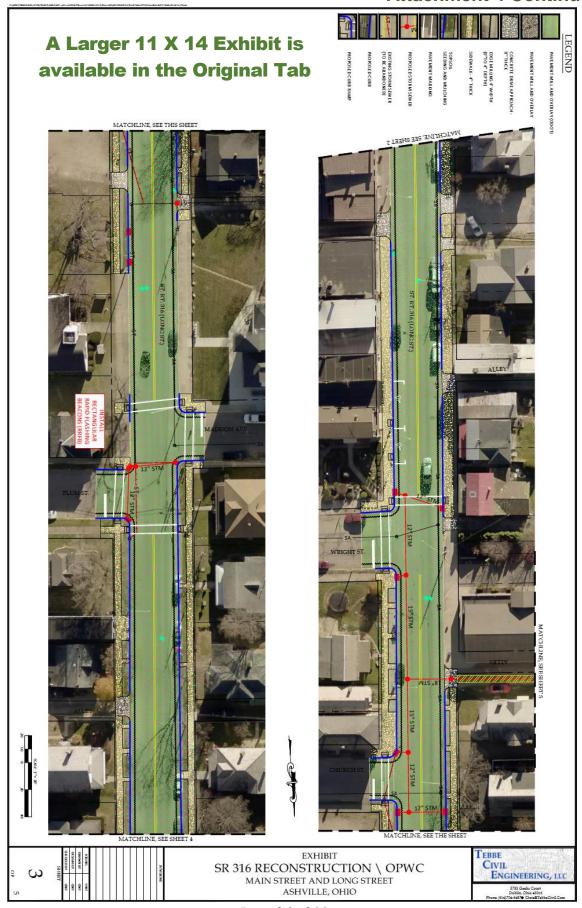



Page 26 of 28

A Larger 11 X 14 Exhibit is available in the Original Tab LEGEND EXHIBIT SR 316 RECONSTRUCTION \ OPWC MAIN STREET AND LONG STREET ASHVILLE, OHIO TEBBE CIVIL ENGINEERING, LLC

A Larger 11 X 14 Exhibit is available in the Original Tab



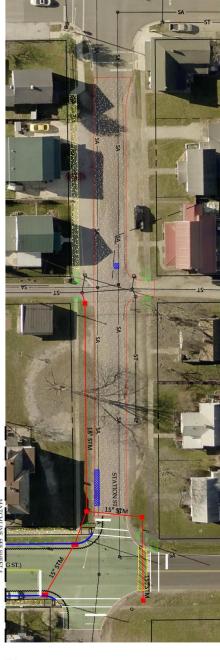

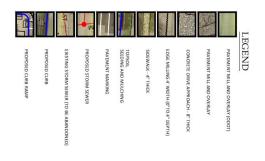



NAME OF THE PROPERTY OF THE PR

EXHIBIT

SR 316 RECONSTRUCTION \ OPWC

MAIN STREET AND LONG STREET

CMT

